

**Table 3 (continued)
XRF Survey Table**

Room	Component	Side	Substrate	Color	Condition	Quantity (if LBP)	Reading (mg/cm ²)	LBP (Y/N)
Mechanical Room 9-Downstairs	Exhaust Cabinet 5	D	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Conduit	D	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Conduit	D	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Mechanical Cabinet 6	D	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Exhaust Cabinet 6	D	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Circuit Cabinet	C	Metal	Gray	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Desk	B	Metal	Dark Gray	Intact	_____	0.00	No
*	Calibration Check	___	Standard	_____	_____	_____	0.00	No
*	Calibration Check	___	Standard	_____	_____	_____	0.00	No
*	Calibration Check	___	Standard	_____	_____	_____	0.00	No
9th Floor Lobby	Elevator Door	B	Metal	Red	Intact	_____	0.05	No
Mechanical Room 9-Downstairs	Elevator Door	B	Metal	Red	Intact	_____	0.06	No
Mechanical Room 9-Downstairs	Elevator Door	D	Metal	Red	Intact	_____	0.08	No
Mechanical Room 9-Downstairs	Roof Crossbeam	B	Metal	Yellow	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Engine #5	___	Metal	Green	Intact	_____	0.18	No
Mechanical Room 9-Downstairs	Engine #5 Base	___	Metal	Green	Intact	_____	0.08	No

**Table 3 (continued)
XRF Survey Table**

Room	Component	Side	Substrate	Color	Condition	Quantity (if LBP)	Reading (mg/cm ²)	LBP (Y/N)
Mechanical Room 9-Downstairs	Gear Housing #5	___	Metal	Silver	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Gear #5	___	Metal	Yellow	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Gear Housing #6	___	Metal	Silver	Intact	_____	0.00	No
Mechanical Room 9-Downstairs	Gear #6	___	Metal	Yellow	Intact	_____	0.00	No
Elevator 10	Outside Cab Wall	___	Drywall	Green	Intact	_____	0.03	No
Elevator 10	Crosshead	___	Metal	Red	Intact	_____	0.02	No
Elevator 10	Gutter Run	___	Metal	Red	Intact	_____	0.02	No
Elevator 3-Pit	Plunger	___	Metal	Red	Intact	_____	0.01	No
Elevator 3-Pit	Access Ladder	___	Metal	Red	Intact	_____	0.00	No
Elevator 3-Pit	Plunger Base	___	Metal	Red	Intact	_____	0.00	No
Elevator 3-Pit	Small Pulley	___	Metal	Red	Intact	_____	0.00	No
Elevator 3-Pit	Large Pulley	___	Metal	Red	Intact	_____	0.00	No
Elevator 3	Wall Panel	___	Metal	White	Intact	_____	0.00	No
Elevator 5	Wall Panel	___	Metal	Red	Intact	_____	0.00	No
Elevator 7	Door	___	Metal	Beige	Intact	_____	0.00	No
Elevator 7	Door Back	___	Metal	Red	Intact	_____	0.00	No
Judge's Elevator	Door	___	Metal	Red	Intact	_____	0.00	No
Judge's Elevator	Wall Panel	___	Metal	Red	Intact	_____	0.00	No
Judge's Elevator	Crosshead	___	Metal	Red	Intact	_____	0.00	No
Judge's Elevator	Door Back	___	Metal	Red	Intact	_____	0.00	No
Mechanical Room 8	Door Frame	A	Metal	Red	Intact	_____	0.00	No
Mechanical Room 9	Door	A	Metal	Red	Intact	_____	0.00	No
9th Floor Lobby	Wall Between Elevator 9/10	B	Plaster	Beige	Intact	_____	0.00	No

**Table 3 (continued)
XRF Survey Table**

Room	Component	Side	Substrate	Color	Condition	Quantity (if LBP)	Reading (mg/cm ²)	LBP (Y/N)
Mechanical Room 8	Wall	A	Plaster	Tan	Intact	_____	0.00	No
Mechanical Room 8	Wall	B	Plaster	Tan	Intact	_____	0.00	No
Mechanical Room 8	Wall	C	Plaster	Tan	Intact	_____	0.00	No
Mechanical Room 8	Wall	D	Plaster	Tan	Intact	_____	0.00	No
Mechanical Room 9	Electrical Box	B	Metal	Tan	Intact	_____	0.00	No
Mechanical Room 10	Conduit	B	Metal	Tan	Intact	_____	0.00	No
Mechanical Room 11	Conduit	C	Metal	Tan	Intact	_____	0.00	No
Mechanical Room 12	Motor #8	B	Metal	Gray	Intact	_____	0.04	No
Mechanical Room 13	Engine #8	___	Metal	Green	Intact	_____	0.08	No
Mechanical Room 14	Engine #8 Base	___	Metal	Green	Intact	_____	0.34	No
Mechanical Room 15	Gear Housing #8	___	Metal	Silver	Intact	_____	0.00	No
Mechanical Room 16	Gear #8	___	Metal	Yellow	Intact	_____	0.00	No
Mechanical Room 17	Conduit	D	Metal	Tan	Intact	_____	0.00	No
Mechanical Room 18	Window Frame	C	Metal	Tan	Intact	_____	0.00	No
Mechanical Room 19	Circuit Cabinet	C	Metal	Gray	Intact	_____	0.00	No

Notes:

ft² square feet

LBP lead-based paint

mg/cm² milligrams per square centimeter

This page is intentionally blank.

Appendix A Certifications

This page is intentionally blank.

State of California
Division of Occupational Safety and Health
Certified Asbestos Consultant

John Carlos Mitchell



Name


97-2289

Certification No.

12/08/18

Expires on

This certification was issued by the Division of Occupational Safety and Health as authorized by Sections 7180 et seq. of the Business and Professions Code.

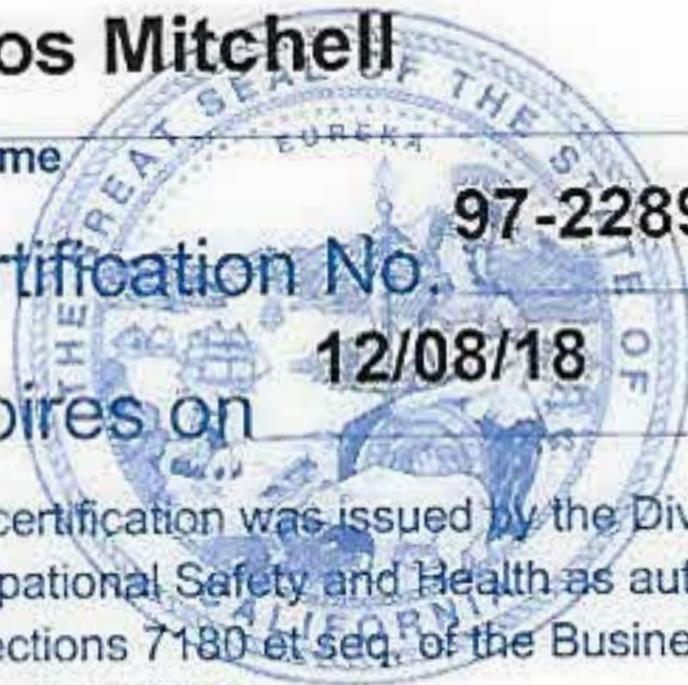

State of California Department of Public Health

Lead-Related
Construction
Certificate

Certificate
Type

Expiration
Date

Inspector/Assessor

07/26/2018

Project Monitor

07/26/2018



John C. Mitchell

ID #: 2933

Appendix B Laboratory Report

This page is intentionally blank.

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831



AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Deigo, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-001 0104-1	Room 9	Int Plaster Rough Coat	White	80% Minerals 15% Carbonate 5% Paint
Total Asbestos	None Detected			
695661-002 0104-2	Room 9	Int Plaster Rough Coat	White	80% Minerals 15% Carbonate 5% Paint
Total Asbestos	None Detected			
695661-003 0104-3	Room 9	Int Plaster Rough Coat	White	80% Minerals 15% Carbonate 5% Paint
Total Asbestos	None Detected			
695661-004 0104-4	Floor 9 E Corridor	Textured Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-005 0104-5	Floor 9 W Corridor	Textured Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Deigo, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-006 0104-6	9th Floor Corridor Ceiling	Textured Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-007 0104-7	9th Floor Upper Platform	Concrete Slab	White	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-008 0104-8	9th Floor Upper Platform	Concrete Slab	White	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-009 0104-9	9th Floor Upper Platform	Concrete Slab	White	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-010 0104-10	Elevator 3 Shaft	Drywall Board	White	85% Sulfate 8% Cellulose 7% Glass Fibers
Total Asbestos	None Detected			
695661-011 0104-11	Elevator 3 Shaft	Drywall Board	White	85% Sulfate 8% Cellulose 7% Glass Fibers
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Deigo, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-012 0104-12	Elevator 3 Shaft	Drywall Board	White	85% Sulfate 8% Cellulose 7% Glass Fibers
Total Asbestos	None Detected			
695661-013 0104-13	Elevator 3 Shaft	Drywall Tape and Mud	White	85% Sulfate 6% Carbonate 5% Cellulose 2% Glass Fibers 2% Paint
Total Asbestos	None Detected			
695661-014 0104-14	Elevator 3 Shaft	Drywall Tape and Mud	White	85% Sulfate 6% Carbonate 5% Cellulose 2% Glass Fibers 2% Paint
Total Asbestos	None Detected			
695661-015 0104-15	Elevator 3 Shaft	Drywall Tape and Mud	White	85% Sulfate 6% Carbonate 5% Cellulose 2% Glass Fibers 2% Paint
Total Asbestos	None Detected			
695661-016 0104-16	Elevator 3	12x12 VFT with Streaks	Tan	100% Non-Fibrous Material
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Diego, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-017 0104-17	Elevator 3	12x12 VFT with Streaks	Tan	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-018 0104-18	Elevator 3	12x12 VFT with Streaks	Tan	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-019 0104-19	9th Floor Upper Platform	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-020 0104-20	9th Floor Upper Platform	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-021 0104-21	9th Floor Lower Platform	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Diego, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-022 0104-22	Penthouse South	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-023 0104-23	Penthouse North	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-024 0104-4	7th Floor Lobby	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-025 0104-25	7th Floor Lobby	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-026 0104-26	6th Floor Mech Room	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Deigo, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-027 0104-27	6th Floor Mech Room	Drywall and Joint Compound	White	85% Sulfate 6% Carbonate 5% Cellulose 4% Paint
Total Asbestos	None Detected			
695661-028 0104-28	Elevator Shaft 8	Fireproofing	Brown	80% Non-Fibrous Material 15% Vermiculite 5% Cellulose
Total Asbestos	None Detected			
695661-029 0104-29	Elevator Shaft 8	Fireproofing	Brown	80% Non-Fibrous Material 15% Vermiculite 5% Cellulose
Total Asbestos	None Detected			
695661-030 0104-30	Elevator Shaft 8	Fireproofing	Brown	80% Non-Fibrous Material 15% Vermiculite 5% Cellulose
Total Asbestos	None Detected			
695661-031 0104-31	6th Floor Mech Room	Fireproofing	White	80% Non-Fibrous Material 15% Cellulose 5% Glass Fibers
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Deigo, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-032 0104-32	6th Floor Mech Room	Fireproofing	White	80% Non-Fibrous Material 15% Cellulose 5% Glass Fibers
Total Asbestos	None Detected			
695661-033 0104-33	Elevator 8 Cab	Carpet Adhesive	Yellow	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-034 0104-34	Elevator 8 Cab	Carpet Adhesive	Yellow	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-035 0104-35	Elevator 8 Cab	Carpet Adhesive	Yellow	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-036 0104-36	Elevator 10 Cab	12x12 VFT with Streak	White	100% Non-Fibrous Material
Total Asbestos	None Detected			
695661-037 0104-37	Elevator 10 Cab	12x12 VFT with Streak	White	100% Non-Fibrous Material
Total Asbestos	None Detected			

Certificate of Analysis
PLM Asbestos Identification

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-1188
 PatriotLab.com
 1041 S. Placentia Avenue, Fullerton, CA 92831

AMEC Froster Wheeler
 Scott Brown
 9177 Sky Park Court
 San Diego, CA 92123

Report Number: 695661
 Project Number:
 Project Name: JCC- ECRC
 Project Location: East County Regional Center

Date Collected: 1/4/2018
 Date Received: 1/8/2018
 Date Analyzed: 1/12/2018
 Date Reported: 1/12/2018

Collected By: John Mitchell
 Claim Number:
 PO Number:
 Number of Samples: 38

Lab/Client ID/Layer	Location	Material Description	Color	Composition (%)
695661-038 0104-38	Elevator 10 Cab	12x12 VFT with Streak	White	100% Non- Fibrous Material
Total Asbestos	None Detected			



Raul Lanuza - Analyst



Kwin Legaspi - Approved By

Bulk sample(s) submitted was (were) analyzed in accordance with the procedure outlined in the US Federal Register 40 CFR 763, Subpart F, Appendix A; EPA-600/R-93/116 (Method for Determination of Asbestos in Building Materials), and EPA-600/M4-82-020 (US EPA Interim Method for the Determination of Asbestos in Bulk Insulation Samples). Samples were analyzed using Calibrated Visual Estimations (CVES); therefore, results may not be reliable for samples of low asbestos concentration levels. Samples of wall systems containing discrete and separable layers are analyzed separately and reported as composite unless specifically requested by the customer to report analytical results for individual layers. This report applies only to the items tested. Results are representative of the samples submitted and may not represent the entire material from which the samples were collected. "None Detected" means that no asbestos was observed in the sample. "<1%" (less than one percent) means that asbestos was observed in the sample but the concentration is below the quantifiable level of 1%. This report was issued by a NIST/NVLAP (Lab Code 200358-0) and CADOHS- ELAP (Cert. No. 2540) accredited laboratory and may not be reproduced, except in full without the expressed written consent of Patriot Environmental Laboratory Services, Inc. This report may not be used to claim product certification, approval or endorsement by NIST, NVLAP, ELAP or any government agency.



Anniversary

Lab Use Only
Report Number: 10951061

tel - 714-899-8900
free - 888-743-0998
fax - 714-899-7098
www.patriotlab.com
1041 S. Placentia Avenue, Fullerton, CA 92831



1/11/18 9:10 AM

CHAIN OF CUSTODY

Client: ~~ISB Scott Brown~~ AMECC Project No.:
 Contact Person: Scott Brown Project Name: JCC- ECRC
 Client Address: 9177 Sky Park Ct Project Location: East County Regional Center
 San Diego, CA 92123
 Contact Phone: 858-514-7724 Sample(s) Collected By: John Mitchell
 Contact Fax: Authorized by: Claim #: PO #:
 How do you want your report? (Circle) Mail Fax Web E-mail: Scott.brown@woodplc.com
 Special Instructions:

Analysis Requested

Turnaround Time (business hours/days)
 RUSH (4 hours) | RUSH (8 hours) | 24 Hr | 48 Hr | 72 Hr | Other (specify) _____
 Notes: 4HR TAT available until 1PM. Viable fungi samples require 5-7 days turnaround minimum. Bacterial cultures require minimum 30hr TAT. STLC/CAL-WET and TCLP minimum TAT are 72hrs.
Asbestos PCM (fiber count) NIOSH 7400A PLM (bulk asbestos) EPA 600/R-93/116 Point Count 400
 CARB 435 Point Count 1000
 Gravimetric Reduction (Gravimetric Reduction Requires Minimum 10hr TAT)

Microbiology

Fungi
 Non-Viable Air Spore Trap, SOP IV.4.1m/2m Viable (Colony ID & Enumeration) Air Swab/Bulk
 Non-Viable Surface Tape Lift/Swab/Bulk, SOP IV.4.3m/4m

Bacteria (Samples must be received by the laboratory within 24hrs of collection or results may be invalid)
 Total Coliform and E. coli - Surfaces, Swabs, and Bulk Solids, Liquids (non-potable, non-wastewater) - Presence / Absence

Chemistry

Lead by Flame AA - EPA 3050B/7420mod, NIOSH 7082mod: Paint Air Dust Wipe Water (non-potable) Soils/Solids
 Lead Waste Profile (by Flame AA)
 1: TTLC Total Threshold by EPA 3050B mod 2: STLC/CAL WET Title 22 CCR Ch11 Article 5 App 2 3: TCLP EPA 1311
 Note: Please provide at approx. 200 grams (approx. 1/2 lb.) of sample for complete profile. Check here to perform all test necessary for disposal

Rotometer Calibration pH testing (soils, misc. solids, & liquids) EPA 9045

Client Sample ID	Sample Type	Date Sampled	Location Sampled	Description of Sample (Material type, dimensions, etc)	Start Time	Stop Time	Avg. (LPM)	Total Min.	Total Vol (Flow x Tot. Min)
0104-1	Bulk	1/04/18	Room 9	Int plaster Rough coat	X				
0104-2			Room 9	Int Plaster Rough coat					
0104-3			Room 9	Int Plaster Rough coat					
0104-4			Room 9 E. corridor	Textured Drywall / SC					
0104-5			Room 9 W corridor	Textured Drywall / SC					

Relinquished By: (Print) John Mitchell Sign: *John Mitchell* Date: 1/4/18 Time:
 Received By: (Print) Scott Brown Sign: *Scott Brown* Date: 1/4/18 Time:
 Relinquished By: (Print) Scott Brown Sign: *Scott Brown* Date: 1/5/18 Time:
 Received By: (Print) J Mitchell Sign: *J Mitchell* Date: 1/6/18 Time: 11:10 AM

Method of Shipment / Preservation During Shipment: Condition of Samples: Acceptable: YES / NO FC/EX
 Comments:

Note: Patriot's holding time for all samples submitted is 30 days for solid samples, 7 days for digests, and immediate for lead in air after analytical results are reported. Unless customer provides written instructions to extend holding time, samples will be disposed of in accordance with local, state and federal laws.

Lab Use Only

Report Number: 60951661

tel - 714-899-8900
 free - 888-743-0998
 fax - 714-899-7098
 www.patriotlab.com

1041 S. Placentia Avenue, Fullerton, CA 92831



Client Sample ID	Sample Type	Date Sampled	Location Sampled	Description of Sample (Material type, dimensions, etc)	Start Time	Stop Time	Avg. (LPM)	Total Min.	Total Vol (Flow x Tot. Min)
0104-6	Belt	1/6/18	9th Floor Corridor ceiling	Textured Drywall / SC					
0104-7			9th Floor upper platform	Concrete slab					
0104-8			9th Floor upper platform	Concrete slab					
0104-9			9th Floor upper platform	Concrete slab					
0104-10			Elevator 3 shaft	Drywall (green board)					
0104-11			Elevator 3 shaft	Drywall (green board)					
0104-12			Elevator 3 shaft	Drywall (green board)					
0104-13			Elevator 3 shaft	Drywall Tape / Mud					
0104-14			Elevator 3 shaft	Drywall Tape / Mud					
0104-15			Elevator 3 shaft	Drywall Tape / Mud					
0104-16			Elevator 3	12x12 UFT Tan w/ streaks					
0104-17			Elevator 3	12x12 UFT Tan w/ streaks					
0104-18			Elevator 3	12x12 UFT Tan w/ streaks					
0104-19			9th Floor upper platform	Drywall / SC					
0104-20			9th Floor upper platform	Drywall / SC					
0104-21			9th Floor lower platform	Drywall / SC					
0104-22			Penthouse - south	Drywall / SC					
0104-23			Penthouse - north	Drywall / SC					
0104-24			7th floor lobby	Drywall / SC					
0104-25			7th Floor lobby	Drywall / SC					
0104-26			6th Floor Mech Room	Drywall / SC					
0104-27			6th Floor Mech Room	Drywall / SC					

Relinquished By: (Print) John Mitchem Sign: [Signature] Date: 1/4/18 Time: _____
 Received By: (Print) Scott Brown Sign: [Signature] Date: 1/4/18 Time: _____
 Relinquished By: (Print) Scott Brown Sign: [Signature] Date: 1/5/18 Time: _____
 Received By: (Print) Jay [Signature] Sign: [Signature] Date: 1/9/18 Time: 11:10 am

Note: Patriot's holding time for all samples submitted is 30 days for solid samples, 7 days for digests, and immediate for lead in air after analytical results are reported. Unless customer provides written instructions to extend holding time, samples will be disposed of in accordance with local, state and federal laws.

Felix

Lab Use Only
Report Number: 10951061

tel - 714-899-8900
free - 888-743-0998
fax - 714-899-7098
www.patriotlab.com
1041 S. Placentia Avenue, Fullerton, CA 92831



Client Sample ID	Sample Type	Date Sampled	Location Sampled	Description of Sample (Material type, dimensions, etc)	Start Time	Stop Time	Avg. (LPM)	Total Min.	Total Vol (Flow x Tot. Min)
0104-28	Bulk	1/14/18	Elevator shaft 8	Fireproofing	X				
0104-29			Elevator shaft 8	Fireproofing					
0104-30			Elevator shaft 8	Fireproofing					
0104-31			6th Floor Mech Room	Fireproofing					
0104-32			6th Floor Mech Room	Fireproofing					
0104-33			Elevator 8 cab	Carpet adhesive					
0104-34			Elevator 8 cab	Carpet adhesive					
0104-35			Elevator 8 cab	Carpet adhesive					
0104-36			Elevator 10 cab	12x12 VFT off wht w/ gray streak					
0104-37			Elevator 10 cab	12x12 VFT off wht w/ gray streak					
0104-38			Elevator 10 cab	12x12 VFT off wht w/ gray streak					
X									

Relinquished By: (Print) John Motelur Sign: [Signature] Date: 1/14/18 Time: _____
 Received By: (Print) Scott Brown Sign: [Signature] Date: 1/14/18 Time: _____
 Relinquished By: (Print) Scott Brown Sign: [Signature] Date: 1/15/18 Time: _____
 Received By: (Print) Juliana Sign: [Signature] Date: 1/18/18 Time: 11:10am

Note: Patriot's holding time for all samples submitted is 30 days for solid samples, 7 days for digests, and immediate for lead in air after analytical results are reported. Unless customer provides written instructions to extend holding time, samples will be disposed of in accordance with local, state and federal laws.

This page is intentionally blank.